

# de Zahnriemen-Spannrollen-Kit Zahnriemen

Ergänzender Einbauhinweis

1 987 948 167 Zahnriemen-/Spannrollen-Kit  
1 987 948 168 Zahnriemen-/Spannelemente-Kit  
1 987 949 601 Zahnriemen



# BOSCH

## Ergänzender Einbauhinweis für folgende Fahrzeugmodelle mit RF-Turbodiesel Motor

- ▶ Mazda 6 (GG/GY)
- ▶ Mazda 5 (CR)
- ▶ Mazda 323 (BJ)
- ▶ Mazda Premacy (CP)
- ▶ Mazda MPV(LW)
- ▶ Mazda 626 (GF/GW)


Ergänzend zur Einbauanleitung lt. ESI[tronic] ist beim Wechsel des Zahnriemens oder des kompletten Kits unbedingt folgender **Hinweis zu beachten:**

**Der Abstand zwischen Gehäuse des hydraulischen Riemenspanners und dem Hebel der Spannrolle darf max. 4,5mm sein. Sollte der Abstand größer sein, muss laut Fahrzeughersteller eine Distanzscheibe**


- ▶ Mazda Bestellnr. RFY0-12-715

eingebaut werden.

### Abstandsmessung Riemenspanner - Hebel Spannrolle

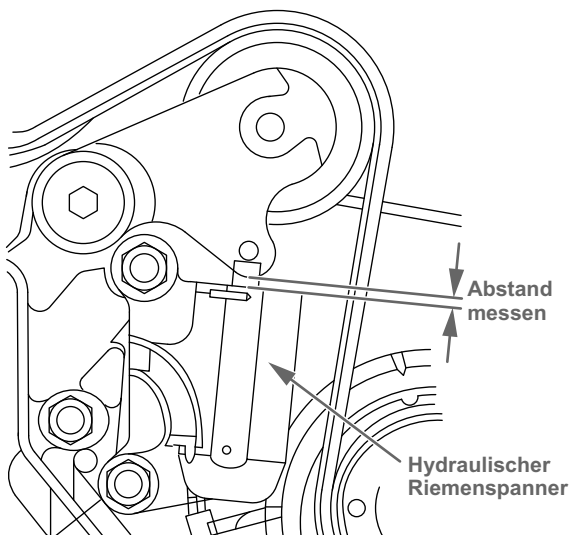

### Lage Distanzscheibe

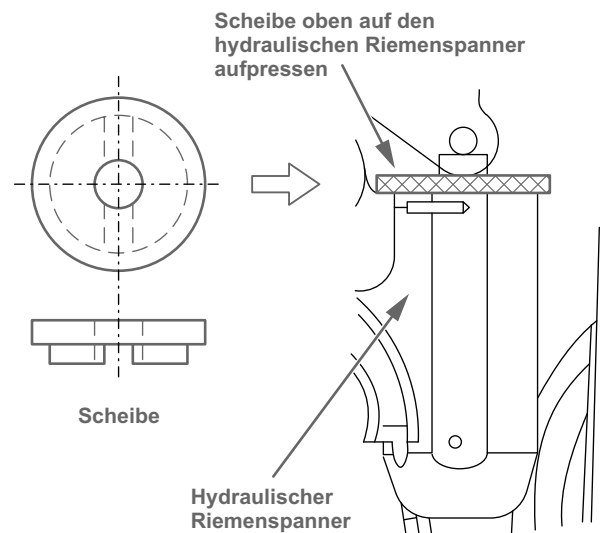

# en Timing Belt/Tensioner Pulley Kit Timing Belt

## Supplementary installation instruction

1 987 948 167 Timing Belt/Tensioner Pulley Kit  
1 987 948 168 Timing Belt/Tensioning Elements Kit  
1 987 949 601 Timing Belt



# BOSCH

### Supplementary installation instruction for the following vehicle models with RF turbo diesel engine

- ▶ Mazda 6 (GG/GY)
- ▶ Mazda 5 (CR)
- ▶ Mazda 323 (BJ)
- ▶ Mazda Premacy (CP)
- ▶ Mazda MPV(LW)
- ▶ Mazda 626 (GF/GW)


Supplementary to the installation instructions according to ESI[tronic], the following **instruction must necessarily be followed** when replacing the timing belt or the complete kit:

**The distance between the housing of the hydraulic belt tensioner and the lever of the tensioning pulley should be max. 4,5 mm. If the distance is greater, then according to the vehicle manufacturer, a spacer**

- ▶ Mazda order no. RFY0-12-715

**must be installed.**

### Distance measurement belt tensioner - lever of the tensioning pulley

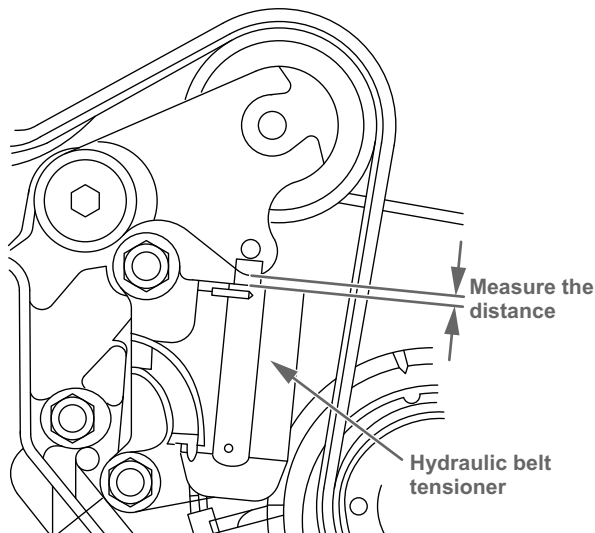

### Location of the spacer

